Certified Inspection Report for:		Contact : -		Site Addre	SHEET			
Manningford Parish Council			Ruth Kinderman Manningford Bruce Recreation Field			t	1	
2 Little Woodborough, Pewsey,			Tel: 01672 851 757		(opposite The Ivies & Village Hall)			of
Wiltshire, SN9 5PL			Email: m.kinderman57@btinternet.com		Wiltshire, SN9 6JH			3
			Our Ref: 1250969 409932	_				
DESCRIPTION OF	MAKER	RISK	INSPECTION COMMENTS	QTY.	PRODUCT	DESCRIPTION OF	UNIT	TOTAL
PRODUCT(S) INSPECTED	& YEAR	RATING			CODE	PART(S) REQUIRED	PRICE	
2 x Football Goal	Forza	М	Generally satisfactory but recommend the nets are secured to the					
on Grass			grass surface to reduce potential trip and snagging hazards					
		М	Uneven grass surfaces could create trip hazards					
Multi-play Unit	Kompan	М	Generally satisfactory but the access platforms are wearing and	1	B610SPEC	110335-A2 Cup Head Bolt M10 x 335mm SS	£37.50	£37.50
on Safety Grass	2012		damaged, recommend both platform panels are replaced as soon as	1	B610SPEC	B610013-09 Step 2 Coated	£87.50	£87.50
			possible	1	B610SPEC	B61001-09 Step Coated	£125.00	£125.00
		L	Monitor wear at the main platform edges	7	B610SPEC	400010-A2 Hexagon Nut M10 Stainless	£1.25	£8.75
				6	B610SPEC	110038-A2 Cup Head Bolt M10 x 38mm SS	£1.25	£7.50
				12	B610SPEC	A0085-18 Donut Top Natural	£1.25	£15.00
				12	B610SPEC	A0086-18 Donut Top Natural	£1.25	£15.00
				1	B610SPEC	Carriage from Kompan	£26.07	£26.07
						Labour cost to fit parts*	£270.00	
Climbing Frame	Unknown		Generally satisfactory but fails BS EN 1176 design criteria at the					
on Grass			following areas:-					
		L	Unit design creates hard object hazards within the falling space					
			(ref BS EN 1176-1:2017, clause 4.2.8.2), no remedial action is					
			possible with unit design					
		L	Monitor the unit stability					
		МН	The provision of a suitable impact surface is recommend below and encompassing the entire unit, the introduction of 'safety grass'					
			matting may provide adequate impact protection and would require					
			minimal base preparation but is reliant upon a good turf and top					
			soil layer, (2.7m maximum fall height and foundation stone exposed					
			at central support tube) (ref BS EN 1176-1:2017, clause 4.2.8.5.2)					
1.8m 1 Bay 2 Seat Swing	Wicksteed	l _M	Generally satisfactory but recommend damaged safety grass matting					
2 x Flat Seat		"	below one seat is repaired or made safe to reduce potential trip					
on Safety Grass			hazards (secure loose edges with cable ties)					
			· · · · · · · · · · · · · · · · · · ·					
Memorial Park Seat	Unknown		Satisfactory condition					
on Paving								
Wicksteed Leisure			INDICATION OF RISK RATING ASSESSMENT	INSPEC		PARTS SUB TOTAL		£322.32
TAIL VALLES	St., Kettering	H/MH	HIGH & MEDIUM HIGH RISK - See Introductory Notes			BALANCE C / FORWARD		£0.00
	ants, NN16 8YJ	M	MEDIUM RISK - See Introductory Notes	DATE :		PARTS TOTAL EXC. CARRIAGE & VAT.	(E&O.E.)	£322.32
Tel: 0	1536 517 028	VL/L	VERY LOW & LOW RISK - See Introductory Notes		17.3.2020	ESTIMATE TO FIT PARTS * Based on all v	works ordered	See sheet 3

Certified Inspection Report for:			Contact : -			Site Address :-			
Manningford Parish Council			Ruth Kinderman			Manningford Bruce Recreation Field			
2 Little Woodborough, Pewsey,			Tel: 01672 851 757			(opposite The Ivies & Village Hall)			
Wiltshire, SN9 5PL			Email: m.kinderman57@btinternet.com			Wiltshire, SN9 6JH		3	
			Our Ref: 1250969 409932						
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
Park Seat	Unknown	L	Generally satisfactory but recommend painting of this seat is	1	2820-002	Primer Per Litre	£20.00	£20.00	
on Grass			included in your current maintenance schedule.	1	2820-012	Black Gloss Paint Per Litre	£20.00	£20.00	
						Labour cost to paint seat*	£270.00		
Perimeter Fence & Hedging		М	Generally satisfactory but would not exclude animals from the area,			Labour cost all work be ordered at the same time			
			in addition, strimmer damage evident at the fence posts, further						
			deterioration could result in wood rot or material and structural failure						
Vehicle Access Gate		М	Generally satisfactory but recommend excess hinge fixing bolt						
			threads are trimmed back and made safe to reduce potential						
			snagging hazards.						
		МН	Gate propped open at time of inspection, allowing unrestricted						
			vehicle access and would not exclude dogs from the area or prevent						
			toddler's leaving the recreation field and entering the adjacent road						
Single Gate		М	Generally satisfactory but recommend excess hinge fixing bolt						
ŭ			threads are trimmed back and made safe to reduce potential						
			snagging hazards.						
		М	Gate can not be fully opened when vehicle gate is in use.						
General: Grass Impact Surfaces		М	Grass is considered suitable for use where Free Fall height is up to						
·			1.5m, but note that grass must be in a well maintained condition,						
			with at least 150mm of soil beneath it. Grass should remain						
			throughout the year, and not become mud or bare earth, it's impact						
			absorbency is dependant on the roots maintaining an un-compacted						
			soil structure (Ref BS EN 1176-1:2017 UK National Foreword)						
General: Tree Health			Recommend a comprehensive survey is carried out on trees within						
			and around the play area by an arboreal specialist to ascertain						
			their health and take appropriate remedial action where required						
General			The provision of litter facilities is recommended.						
340 L	land I alarma I ()		INDICATION OF RISK RATING ASSESSMENT	INCDEO	TED BY : -	DARTE CUR TOTAL		C40.00	
	teed Leisure Ltd St., Kettering		HIGH & MEDIUM HIGH RISK - See Introductory Notes	INSPEC		PARTS SUB TOTAL BALANCE C / FORWARD		£40.00 £322.32	
	ot., Kettering ints, NN16 8YJ	M	MEDIUM RISK - See Introductory Notes	DATE : -		PARTS TOTAL EXC. CARRIAGE & VAT.	(E&O.E.)	£322.32 £362.32	
							,		
Tel: 01536 517 028		VL/L	VERY LOW & LOW RISK - See Introductory Notes		17.3.2020	ESTIMATE TO FIT PARTS * Based on all w	vorks ordered	See sheet 3	

Certified Inspection Report for: Manningford Parish Council			Contact : - Ruth Kinderman			Site Address :- Manningford Bruce Recreation Field (opposite The Ivies & Village Hall)			
2 Little Woodborough, Pewsey,			Tel: 01672 851 757			of			
Wiltshire, SN9 5PL			Email: m.kinderman57@btinternet.com			3			
		T	Our Ref: 1250969 409932	1					
DESCRIPTION OF PRODUCT(S) INSPECT	MAKER ED & YEAR	RISK RATING		QTY.	PRODUCT CODE	DESCRIPTION OF UNIT PART(S) REQUIRED PRICE	TOTAL		
			The provision of a sign (pictogram) is recommended giving the following information:			A wide range of signs are available, visit www.wicksteed.co.uk or contact			
			a) General emergency telephone number			sales@wicksteed.co.uk for more information			
			b) Telephone number to contact maintenance personnel						
			c) Name of the playground						
			d) Address of the playground						
			e) Other relevant local information, if applicable						
			(ref: BS EN 1176-7:2008 clause 8.2.4)						
		М	The facility is located within an enclosed area but fencing and gates						
			would not physically prohibit access by dogs, recommend routine						
			inspections include monitoring for and removal of animal faeces.						
			(Litter (animal droppings) order 1991 of The Environment Protection						
			Act 1990 requires public walks and pleasure grounds to be free of						
			animal faeces)						
						rpii			
						OUTDOOR 2 0 2 0			
	Wicksteed Leisure Ltd		INDICATION OF RISK RATING ASSESSMENT	INSPEC		PARTS SUB TOTAL	£0.00		
WICYCTEED roii	Digby St., Kettering	H/MH	HIGH & MEDIUM HIGH RISK - See Introductory Notes	1		BALANCE C / FORWARD	£362.32		
THE PARTY OF THE P	Northants, NN16 8YJ	M	MEDIUM RISK - See Introductory Notes	DATE :		PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E	<i>'</i>		
Tel: 01536 517 028 VL/L		VL/L	VERY LOW & LOW RISK - See Introductory Notes		17.3.2020	ESTIMATE TO FIT PARTS * Based on all works ordered			
www.wicksteed.co.uk						TOTAL COST OF WORKS, EXC VAT	£902.32		